

General information as follows:

1. Key blank references are for the profile only, using one of the more well-known blank numbers. This list does not include all variations of different head shapes, lengths, or transponders, the main object is to identify which key profile enters the lock.

2. Unless specified otherwise all locks using single sided keys GM-A through GM-K have universal groove that will accept all 8 keyway variations. These locks will not accept the pre-1967 B10/B11 keys.

3. Unless specified otherwise pawls are not included with replacement locks, the original pawls must be reused.

4. Items marked DWO are discontinued when out. The part numbers are listed for the benefit of those who already have stock.

IMPORTANT: RIGHT SIDE (RH) is the PASSENGER SIDE, LEFT SIDE (LH) is the DRIVER SIDE. If only one part number is listed, that part number can be used on either side.

| Model | Years | Key | Part description | Part no. | Part description Part no. Notes | | Notes | |
|--|---------|-------|--|-------------------|---|--------|---|--|
| Most models | 1949-66 | B10 | Coded lock cylinder pushbutton assembly (fits into door handle) | D-41-101 (DWO) | NOTE: Several variations of this lock were used, D-41-101 is 3-1/8 inc overall length. All other variations are available from classic Chevroler parts suppliers only. Use tumbler series P-41-101/105 | | | |
| 4000-7000 (Medium Duty) | 1967-90 | GMA/K | Uncoded service pack | DL1580U | Coded pair | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | |
| 4000-7000 (Medium Duty) | 1991-94 | GMA/K | Uncoded service pack | DL1539U | Coded pair | DL1539 | Use tumbler series P-41-101/105 | |
| Acadia | 2007-16 | B111 | Uncoded service pack | D-41-003 | Use tumbler series P-41-011/015 for D-41-003 sold by ASP. Different tumblers may be used for locks not sold by ASP including some locks sold by GM dealers or originally installed on the car when it was new. | | | |
| Acadia | 2017-19 | HU100 | Replacement locks available from Strattec Use tumbler series P-23-121/134 | | | | | |
| Astro 95 heavy duty truck | All | GMA/K | Uncoded service pack | DL1580U | Coded pair | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | |
| C/K Pickup (full size) | 1967-87 | GMA/K | Uncoded service pack | DL1580U | Coded pair | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | |
| C/K Pickup (full size) | 1988-94 | GMA/K | Uncoded service pack | DL1539U | Coded pair | DL1539 | Use tumbler series P-41-101/105 | |
| C/K Pickup (full size) | 1995-98 | B97 | Coded pair | DL1988 | Use tumbler series P-41-161/164 | | | |
| C/K Pickup (full size) GMT400 series | 1999-00 | B97 | Coded pair DL1988 Use tumbler series P-41-161/164 NOTE YEAR OVERLAPS: In 1999 these trucks were produced in both the old style GMT400 and the new style GMT800 series. For 2000 the 2500 and 3500 Crew Cab and Chassis Cab were produced as the old GMT400 series. | | | | | |
| C/K Pickup (full size) GMT800 series | 1999-00 | B99 | Replacement locks available from Strattec | | | | | |
| C/K Pickup (full size) GMT800 series | 2001-06 | B99 | Coded lock | D-41-007 | Includes extra tumblers for rekeying. The face cap can be removed without destroying it. | | | |
| C/K Pickup (full size) GMT800 series Canada Sierra Classic | 2007-09 | B99 | Coded lock | D-41-007 | Includes extra tumblers for rekeying. The face cap can be removed without destroying it. | | The face cap can be removed | |
| C/K Pickup (full size) GMT900 series | 2007-13 | B111 | Replacement locks available from Strattec | | | | | |
| C/K Pickup (full size) | 2014-19 | HU100 | NOTE: Some 2014 models used the same locks as 2013, identify by the keyway. Replacement locks available from Strattec Use tumbler series P-23-121/134 | | | | | |

Scroll down for more





WWW.KEY4.COM



| Caballero | 1978 | GMA/K | Uncoded service pack | DL1580U | Coded pair | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | | | |
|-------------------------------|---------|----------|---|--|---|-----------------|---|--|--|--|
| Caballero | 1979-87 | GMA/K | Uncoded service pack | DL1582U | Coded pair | DL1582 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | | | |
| Canyon | 2004-12 | B110 | Complete lock RH | D-24-122 | Complete lock LH | D-24-123 | Use face cap P-30-268 Use tumbler series P-24-121/124 | | | |
| Canyon | 2015-18 | HU100 | Replacement locks available from Strattec Use tumbler series P-23-121/134 | | | | | | | |
| Denali | All | | see GMC Suburban | | | | | | | |
| Envoy | 2002-09 | B99 | Coded lock D-41-007 Includes extra tumblers for rekeying. without destroying it. | | | | The face cap can be removed | | | |
| G series van | 1967-95 | GMA/K | Uncoded service pack | DL1580U | Coded pair | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | | | |
| (full size) | | | | Lock separate from the door handle only, locks designed with the cylinder in the push button are no longer | | | | | | |
| | | | Uncoded service pack (chrome) | DL1580U | Coded pair (chrome) | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | | | |
| Jimmy C/5, K/5 (full size) | 1967-91 | GMA/K | Uncoded service pack (black) | DL1525U | Coded pair (black) | DL1525 | Use face cap RP6520 (P-41-202) Use tumbler series P-41-101/105 | | | |
| | | | Uncoded service pack | | | | | | | |
| Jimmy S15 | 1982-94 | GMA/K | Uncoded service pack (chrome) | DL1580U | Coded pair (chrome) | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | | | |
| (compact size) | 1902-94 | GWAR | Uncoded service pack (black) | DL1525U | Coded pair (black) | DL1525 | Use face cap RP6520 (P-41-202) Use tumbler series P-41-101/105 | | | |
| Jimmy S15 (compact size) | 1995-05 | B99 | Replacement locks avai Use tumbler series P-41 | | attec | | | | | |
| LCF 3500, | 2008 10 | V075 | | | evrolet / GMC dealers only | | | | | |
| 4500, 5500 | 2008-18 | X275 | | Tumblers and other service parts are not available. | | | | | | |
| Pickup | 1967-18 | | | , S-15 compac | t size pickup, Canyon com | pact size pick | • | | | |
| S15, Sonoma | 1982-94 | GMA/K | Uncoded service pack (chrome) | DL1580U | Coded pair (chrome) | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | | | |
| pickup | 1002 01 | Children | Uncoded service pack (black) | DL1525U | Coded pair (black) | DL1525 | Use face cap RP6520 (P-41-202) Use tumbler series P-41-101/105 | | | |
| S15, Sonoma pickup | 1995-04 | B97 | Replacement locks available from Strattec Use tumbler series P-41-161/164 | | | | | | | |
| | | | Uncoded service pack (front doors and side door) D-41-203 Use face cap RP6036 (P-41-201) chrome or RP6520 (P-41-202) black Use tumbler series P-41-101/105 | | | | | | | |
| Safari van | 1984-95 | GMA/K | 4-piece lock set (2 front door locks, side door lock, rear cargo door lock) non-electric | DL1515 (DWO) | same as DL1515 except with electric switch on the rear cargo door lock | DL1516 (DWO) | | | | |
| Safari van | 1996-05 | B97 | Replacement locks available from Strattec Use tumbler series P-41-161/164 | | | | | | | |
| Savana van | 1996-08 | B97 | See G-series van (full size) Use tumbler series P-41-161/164 | | | | | | | |
| Savana van | 2007-14 | B111 | | Replacement locks available from Strattec | | | | | | |
| Savana van | 2015-18 | HU100 | Replacement locks available from Strattec Use tumbler series P-23-121/134 | | | | | | | |
| Sonoma | All | | see S15 | | | | | | | |
| Sprint | 1971-77 | GMA/K | Uncoded service pack | DL1580U | Coded pair | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | | | |
| | 1967-91 | | Uncoded service pack (chrome) | DL1580U | Coded pair (chrome) | DL1580 | Use face cap RP6036 (P-41-201) Use tumbler series P-41-101/105 | | | |
| Suburban | | GMA/K | Uncoded service pack (black) | DL1525U | Coded pair (black) | DL1525 | Use face cap RP6520 (P-41-202) Use tumbler series P-41-101/105 | | | |
| | | | 3-piece lock set (2 front doors + rear door) – chrome only | nt doors + rear DL1517 DL1517 Is used only for Suburban with drap down roar tail | | | | | | |
| Suburban | 1992-94 | GMA/K | Coded pair | DL1539 | Coded 3-piece set 2 front doors + tailgate | DL1518 (DWO) | | | | |
| | | | Uncoded service pack | DL1539U | Use tumbler series P-41 | | | | | |
| Suburban | 1995-99 | B97 | Coded pair | DL1988 | | | | | | |
| Suburban | 2000 | B97 | Replacement locks avai | nt locks available from Strattec | | | | | | |
| Suburban | 2001-07 | B97 | Coded lock | D-41-007 | Includes extra tumblers for releaving The face can can be removed | | | | | |
| Suburban | 2008-14 | B111 | Replacement locks available from Strattec | | | | | | | |
| Suburban | 2015-19 | HU100 | Replacement locks available from Strattec Use tumbler series P-23-121/134 | | | | | | | |
| | All | 1 | see S15 | | | | | | | |

Scroll down for more







| Top Kick (Medium Duty) | 1995-02 | GMA/K | Uncoded service pack | DL1539U | Coded pair | DL1539 | Use tumbler series P-41-101/105 | | |
|---------------------------|-------------------------|-------|--|-------------------|---|--------|---------------------------------|--|--|
| Top Kick (Medium Duty) | 2003-05 | B97 | Replacement locks available from Strattec Use tumbler series P-41-161/164 | | | | | | |
| Tracker | 1999-04 | B69 | Uncoded service pack | D-33-204 | Original pawls must be reused. Use face cap P-20-265 Use tumbler series P-20-131/155 | | | | |
| Typhoon | All | | see Jimmy S15 | | | | | | |
| Van | All | | See G-series van full size, Savana van full size, Safari van compact size | | | | | | |
| W4, W5 Tiltmaster | 1986-87 | B57 | Coded lock without pawl | D-24-107 (DWO) | If original pawl cannot be reused, use P-30-324 (RH) or P-30-325 (LH) Use face cap P-30-271 Use tumbler series P-24-101/104 | | | | |
| W4, W5 Tiltmaster | 1988-07 | B65 | Complete lock LH | D-24-118 | Right side door lock previously available as D-24-117. Now use D-24-118 and reuse the original right side pawl. Use face cap P-30-211 Use tumbler series P-30-161/164 | | | | |
| W6, W7 Forward | All using B54 key | B54 | Coded pair (must reuse original pawls) | DP-16-106 | NOTE: DP-16-106 is available with DA25 keyway only and cannot be rekeyed to the original B54 key. Locks using the B54 keyway previously available as D-24-108, now available from Chevrolet / GMC / Isuzu truck dealers only. Use face cap P-16-205 (for original locks and DP-16-106) Use tumbler series P-16-161/164 (for original locks and DP-16-106) | | | | |
| Yukon | 1992-94 | GMA/K | Uncoded service pack | DL1539U | Coded pair DL1539 Use tumbler series P-41-10 | | Use tumbler series P-41-101/105 | | |
| Yukon | 1995-00 | B97 | Coded pair | DL1988 | Use tumbler series P-41-161/164 | | | | |
| Yukon | 2001-07 | B97 | Coded lock | D-41-007 | Includes extra tumblers for rekeying. The face cap can be removed without destroying it. | | | | |
| Yukon | 2008-14 | B111 | Replacement locks available from Strattec | | | | | | |
| Yukon | 2015-19 | HU100 | Replacement locks available from Strattec Use tumbler series P-23-121/134 | | | | | | |

Which tumblers and keying kits to use:

The chart below lists which tumblers and keying kits to use according to which key blank the lock uses.

General Motors is different from most other car manufacturers because locks using the same keyway may use different tumblers depending upon who manufactured the lock and in some cases when it was manufactured. Also some replacement locks may use tumblers different from the lock installed on the car when it was built and which are not available from any known source. As such these tumbler references are correct only to the extent of information that is available to us.


To help avoid confusion, whenever possible the year and model section includes which tumbler series to use in the notes section.

| Key Blank | Tumbler #1 depth | Tumbler #2 depth | Tumbler #3 depth | Tumbler #4 depth | Tumbler #5 depth | Keying kits and Notes |
|-----------|------------------------------|------------------------------|------------------------------|------------------------------|------------------------------|--|
| B10, B11 | P-41-101 RP6038 322051 | P-41-102 RP6039 322052 | P-41-103 RP6040 322053 | P-41-104 RP6041 322054 | P-41-105 RP6042 322055 | SK6035 keying kit supplied by ASP |
| B53, B57 | P-24-101 | P-24-102 (DWO) | P-24-103 | P-24-104 (DWO) | | Contained in A-24-101 and A-30-150 keying kits which are no longer available for purchase. Refill packs of the individual tumblers will continue to be available until sold out. |
| B54 | P-16-161 | P-16-162 | P-16-163 | P-16-164 | | A-16-106 current keying kit Also contained in the A-16-100 and A-16-101 keying kits which are no longer available for purchase. |
| B65 | P-30-161 | P-30-162 | P-30-163 | P-30-164 | | A-30-106 current keying kit Also contained in the A-30-150 keying kit which is no longer available for purchase. |

Scroll down for more





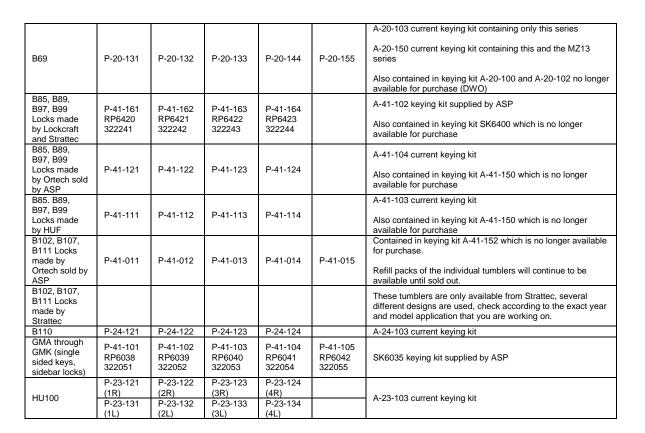

Tumbler springs:

For sidebar locks using single bitted keys B10, B11, GMA/GMK - part no. RP6037 (P-41-100)

For locks using double bitted keys B97, etc. - part no. RP6419

For locks using HU100 2-track high security keys - part no. P-31-100

For locks using B53, B54, B57, B69, B110, and other similar keys (Japanese design locks) P-00-100 - currently active part number - 100 springs per pack This spring can also be substituted to use in locks using double bitted keys B97, etc.:

Part numbers previously used, now superseded to P-00-100

| P-16-105 | P-30-108 |
|----------|----------|
| P-19-100 | RP6546 |
| P-20-105 | RP6612 |
| P-20-115 | RP6731 |
| P-24-105 | RP6822 |
| P-30-105 | |





